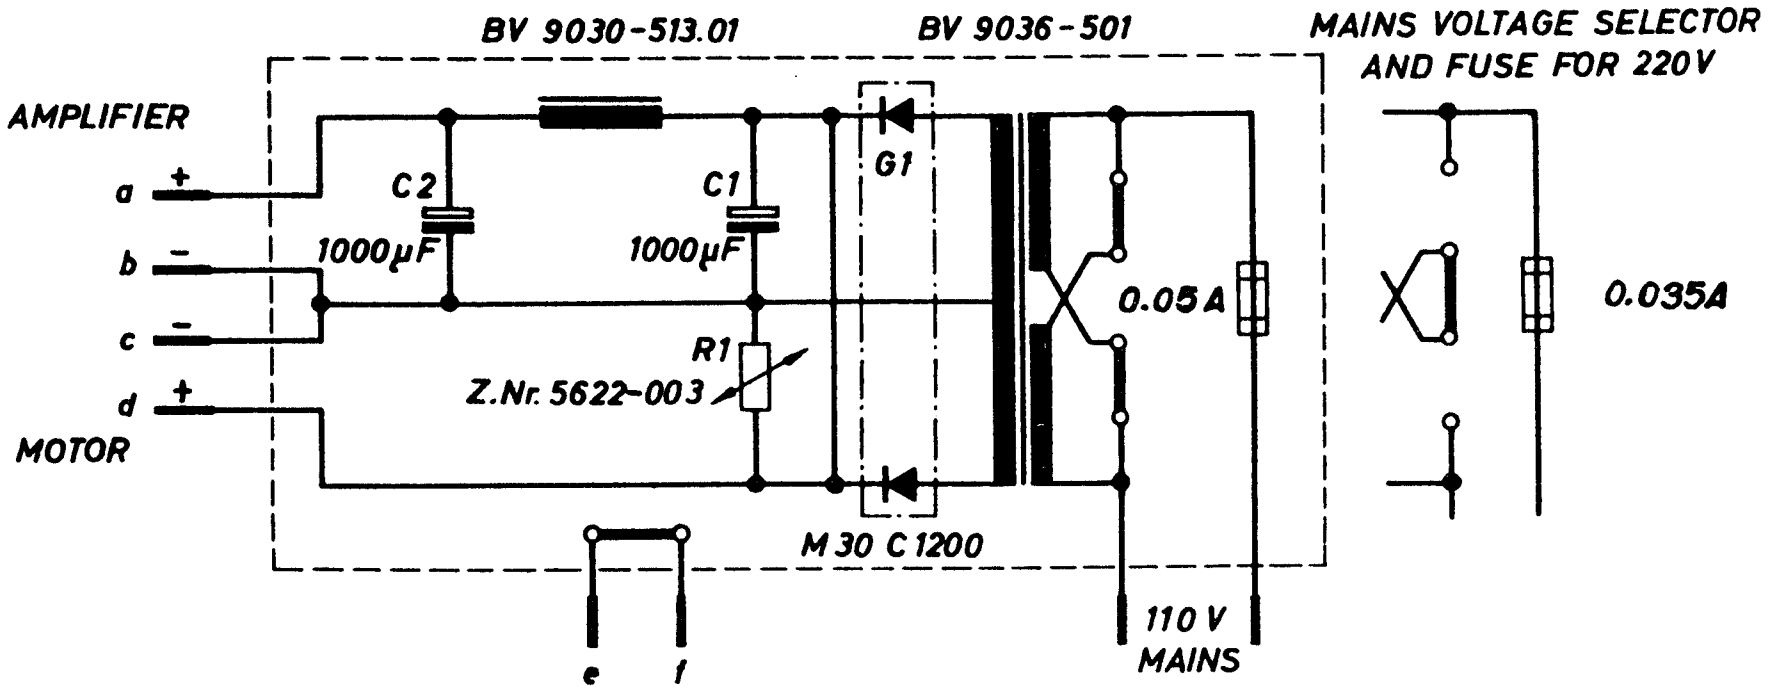

GRUNDIG WERKE FÜRTH (BAY.)

Power Pack

f. Stenorette R/B

5622-3000

Power Pack Stenorette B/R

110 V Position

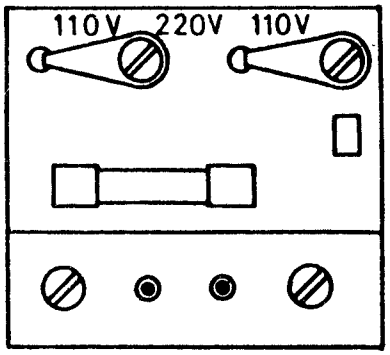

220 V Position

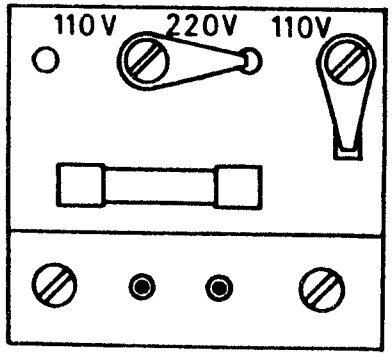

This power pack can be easily mounted on the place of the battery container. The power pack must not be removed even when the Stenorette is fed from a car battery. Prior to connecting your power pack to line, please check that voltage and current correspond with the ones used in your home. This power pack can be operated from A.C. supplies 50/60 cps. It leaves the factory set to 110 volts. For conversion to 220 volts, first disconnect line cord. Loosen the plug-in connection of the power pack and open the casing by separating carefully the pins of the plastic cover plate from the slots in the case. To remove the cover plate, lift it slightly by a screw driver. Tilt over the casing and slide the mechanisme in your open hand.

Loosen the contact screws (don't screw out) and set the metal strips to the required position as per the figure. Re-tighten the screws. For conversion of voltage and replacement of defect fuses, always observe the rating of the fuse which must be for

220 V 35 mA = 0.035 A

110 V 50 mA = 0.05 A